

RECORD OF SURVEY No. 32-83

IN THE UNINCORPORATED TERRITORY OF THE COUNTY OF MONO, STATE OF CALIFORNIA,
BEING PORTIONS OF THE TOWNSHIP LINE COMMON TO TOWNSHIPS 3 AND 4 NORTH, RANGES 24 AND 25 EAST, TOGETHER
WITH THE TAMARACK MINE HOLDINGS IN SECTION 3, TOWNSHIP 3 NORTH, RANGE 24 EAST, MOUNT DIABLO MERIDIAN

MONUMENT DESCRIPTIONS:

902015 FOUND A 2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "VV.2 IN.1 MS. 6766" (FOR VALLEY VIEW MILLSITE CORNER No. 2, INSPIRATION MILLSITE CORNER No. 1, MINERAL SURVEY No. 6766), 10 INCHES ABOVE THE TOP OF A MOUND OF STONES, 2.5 FEET IN DIAMETER AND 10 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN GREAT CONDITION, STRAIGHT AND SOLID, LEFT AS IS AND REBUILT MOUND OF STONES. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.5 FEET EASTERLY. FOUND 1966 BEARING TREES:



BT1: AN 18 INCH DEAD ASPEN, S72°E, 6.0 FEET
BT2: A 15 INCH ASPEN, S30°E, 9.3 FEET
ADDED, TO THE LIVE TREE, A FOREST SERVICE 54-3 BEARING TREE SIGN AND A 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR A CHAINING POINT AT CENTER RIGHT SIDE

902020 FOUND A 1 1/2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "IN.2 MS.6766" (FOR INSPIRATION MILLSITE CORNER No. 2, MINERAL SURVEY No. 6766), 8 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN GREAT CONDITION, STRAIGHT AND SOLID, LEFT AS IS AND ADDED A COLLAR OF STONES SURROUNDING THE MONUMENT. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN, 1.5 FEET SOUTHEASTERLY. FOUND 1966 BEARING TREES:



BT1: A 9 INCH ASPEN, S80°E (RECORD WAS S8°E), 10.0 FEET
BT2: A 16 INCH ASPEN, S45°E, 10.4 FEET
SET NEW BEARING TREES SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT3: A 12 INCH JUNIPER, N60°W, 20.8 FEET
BT4: A 10 INCH JUNIPER, S42°W, 33.2 FEET

902030 FOUND A 1 1/2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "IN.3 MS.6766" (FOR INSPIRATION MILLSITE CORNER No. 3, MINERAL SURVEY No. 6766), 10 INCHES ABOVE THE TOP OF A MOUND OF STONES, 2.5 FEET IN DIAMETER AND 10 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN GREAT CONDITION, STRAIGHT AND SOLID, LEFT AS IS AND REBUILT THE MOUND OF STONES TO 3.0 FEET IN DIAMETER AND 1.0 FEET ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.5 FEET SOUTHWESTERLY. FOUND 1966 BEARING TREES:



BT1: A 9 INCH DEAD ASPEN, S17°W, 9.9 FEET
BT2: A 9 INCH ASPEN, SOUTH, 10.8 FEET
ADDED, TO THE LIVE TREE, A FOREST SERVICE 54-3 BEARING TREE SIGN AND A 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR A CHAINING POINT AT CENTER RIGHT SIDE

902035 FOUND A 2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "IN.4 VV.3 MS.6766" (FOR INSPIRATION MILLSITE CORNER No. 4, VALLEY VIEW MILLSITE CORNER No. 3, MINERAL SURVEY No. 6766), 10 INCHES ABOVE THE TOP OF A MOUND OF STONES, 2.0 FEET IN DIAMETER AND 8 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN GREAT CONDITION, STRAIGHT AND SOLID, LEFT AS IS AND REBUILT THE MOUND OF STONES, TO 2.0 FEET IN DIAMETER AND 12 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN, 1.2 FEET WESTERLY. FOUND 1966 BEARING TREES:



BT1: A 15 INCH DEAD ASPEN, S36°E, 7.0 FEET
BT2: AN 18 INCH ASPEN STUMP, N88°E, 16.4 FEET
SET A NEW BEARING TREE SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT3: A 14 INCH JEFFREY PINE, S44°E, 63.5 FEET

902040 FOUND A 1 1/2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "VV.4 MS.6766" (FOR VALLEY VIEW MILLSITE CORNER No. 4, MINERAL SURVEY No. 6766), 12 INCHES ABOVE THE TOP OF A MOUND OF STONES, 3.0 FEET IN DIAMETER AND 6 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN FAIR CONDITION, LEANING TO THE NORTH. RE-PLUMBED MONUMENT AND REBUILT MOUND OF STONES TO 3.5 FEET IN DIAMETER AND 18 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.5 FEET NORTHWESTERLY. SET A NEW BEARING TREE SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT1: A 10 INCH YELLOW PINE, N53°W, 91.8 FEET



MONUMENT DESCRIPTIONS:


903010 FOUND A 2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "T.1 6766" (FOR TAMARACK LODGE CORNER No. 1, MINERAL SURVEY No. 6766), 16 INCHES ABOVE THE GROUND, ENCIrcLED BY A COLLAR OF STONES, 1.5 FEET IN DIAMETER. MONUMENT WAS FOUND IN POOR CONDITION, LEANING DOWNHILL. RE-PLUMBED MONUMENT AND BUILT A MOUND OF STONES, 3.5 FEET IN DIAMETER AND 18 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.5 FEET NORTHERLY. SET A NEW BEARING TREE SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT1: A 20 INCH FIR, N72°E, 26.7 FEET



903020 FOUND A 2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "T.2 6766" (FOR TAMARACK LODGE CORNER No. 2, MINERAL SURVEY No. 6766), 18 INCHES ABOVE THE TOP OF A CRUMBLED MOUND OF STONES. MONUMENT WAS FOUND IN POOR CONDITION, LEANING DOWNHILL. RE-PLUMBED MONUMENT AND BUILT A MOUND OF STONES, 3.0 FEET IN DIAMETER AND 18 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.5 FEET NORTHEASTERLY. SET A NEW BEARING TREE SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT1: A 20 INCH LODGEPOLE, S52°E, 75.5 FEET



903030 FOUND A 2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "T.3 6766" (FOR TAMARACK LODGE CORNER No. 3, MINERAL SURVEY No. 6766), 10 INCHES ABOVE THE TOP OF A MOUND OF STONES, 2 FEET IN DIAMETER AND 8 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN GREAT CONDITION, STRAIGHT AND SOLID, LEFT AS IS AND REBUILT MOUND OF STONES TO 2.0 FEET IN DIAMETER AND 12 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.2 FEET EASTERLY. FOUND ORIGINAL 1966 BEARING TREES:
BT1: A 12 INCH ASPEN, S23°W, 3.9 FEET
BT2: AN 8 INCH ASPEN, N13°E, 9.8 FEET
ADDED, TO EACH TREE, A FOREST SERVICE 54-3 BEARING TREE SIGN AND A 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR A CHAINING POINT AT CENTER RIGHT SIDE. SET NEW BEARING TREES SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT3: A 14 INCH FIR, N20°E, 25.5 FEET
BT4: A 10 INCH FIR, S26°E, 25.6 FEET

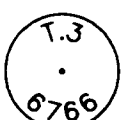

903040 FOUND A 2 INCH IRON PIPE WITH A 2 INCH BRASS CAP STAMPED "T.EX 1-2 6766" (FOR TAMARACK EXTENSION No. 1, CORNER No. 2, MINERAL SURVEY No. 6766), 8 INCHES ABOVE THE TOP OF A MOUND OF STONES, 2 FEET IN DIAMETER AND 6 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN GREAT CONDITION, STRAIGHT AND SOLID, LEFT AS IS AND REBUILT MOUND OF STONES TO 2.0 FEET IN DIAMETER AND 10 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.2 FEET NORTHERLY. FOUND 1966 BEARING TREE:
BT1: A 12 INCH ASPEN, N43°W, 19.7 FEET
ADDED, TO BT1, A FOREST SERVICE 54-3 BEARING TREE SIGN AND A 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR A CHAINING POINT AT CENTER RIGHT SIDE. SET A NEW BEARING TREE SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT2: A 16 INCH FIR, S45°W, 24.3 FEET



903050 FOUND A 1 1/4 INCH IRON PIPE WITH A 2 INCH BRASS CAP STAMPED "T.EX 1-3 6766" (FOR TAMARACK EXTENSION No. 1, CORNER No. 3, MINERAL SURVEY No. 6766), 12 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN FAIR CONDITION, LEANING SLIGHTLY TO THE NORTH. RE-PLUMBED MONUMENT AND BUILT A MOUND OF STONES, 2.0 FEET IN DIAMETER AND 10 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.0 FEET SOUTHERLY. NO ORIGINAL OR NEW BEARING TREES IN THE VICINITY.




MONUMENT DESCRIPTIONS:

903060 FOUND A 2 INCH IRON PIPE WITH A 2 INCH BRASS CAP STAMPED "OM1.2-T.EX.1.4 6766" (FOR OLD MEXICO No. 1 LODGE, CORNER No. 2, TAMARACK EXTENSION No. 1, CORNER No. 4, MINERAL SURVEY No. 6766), 10 INCHES ABOVE A MOUND OF STONES, 2.5 FEET IN DIAMETER AND 8 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN FAIR CONDITION, LEANING SLIGHTLY TO THE NORTH. RE-PLUMBED MONUMENT AND REBUILT MOUND OF STONES TO 2.5 FEET IN DIAMETER AND 10 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 1.3 FEET SOUTHWESTERLY. FOUND 1966 BEARING TREES:
BT1: A 26 INCH TAMARACK, S44°E, 61.6 FEET
BT2: A 16 INCH TAMARACK, S77°W, 32.7 FEET (RECORD WAS 82.2 FEET)
ADDED, TO EACH TREE, A FOREST SERVICE 54-3 BEARING TREE SIGN AND A 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR A CHAINING POINT AT CENTER RIGHT SIDE



903070 FOUND A 1 1/2 INCH IRON PIPE WITH A 2 INCH BRASS CAP STAMPED "OM.1-3 6766" (FOR OLD MEXICO No. 1 LODGE, CORNER No. 3, MINERAL SURVEY No. 6766), 18 INCHES ABOVE THE GROUND ENCIrcLED BY A COLLAR OF STONES, 2 FEET IN DIAMETER. MONUMENT WAS FOUND IN GOOD CONDITION, STRAIGHT AND SOLID. LEFT AS IS AND BUILT A MOUND OF STONES, 3.5 FEET IN DIAMETER AND 18 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 2.0 FEET SOUTHWESTERLY. FOUND 1966 BEARING TREE:
BT1: A 26 INCH JUNIPER (RECORD CALLED IT A TAMARACK), N08°W, 135.7 FEET



903080 FOUND A 1 1/2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "OM.1.4 6766" (FOR OLD MEXICO No. 1 LODGE, CORNER No. 4, MINERAL SURVEY No. 6766), IN A MOUND OF STONES, 3 FEET IN DIAMETER AND 17 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN FAIR CONDITION, LEANING SLIGHTLY. RE-PLUMBED MONUMENT AND REBUILT MOUND OF STONES TO 4.0 FEET IN DIAMETER AND 24 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 2.5 FEET NORTHERLY. NO ORIGINAL OR NEW BEARING TREES IN THE VICINITY.



903090 FOUND A 2 INCH IRON PIPE WITH A 1 3/8 INCH BRASS CAP STAMPED "T.4 6766" (FOR TAMARACK LODGE CORNER No. 4, MINERAL SURVEY No. 6766), 18 INCHES ABOVE A MOUND OF STONES, 3 FEET IN DIAMETER AND 14 INCHES ABOVE THE GROUND. MONUMENT WAS FOUND IN GREAT CONDITION, STRAIGHT AND SOLID. REBUILT MOUND OF STONES TO 3.0 FEET IN DIAMETER AND 18 INCHES ABOVE THE GROUND. SET A U CHANNEL ALUMINUM POST WITH A FOREST SERVICE 54-9 MONUMENT SIGN AND A FOREST SERVICE 54-2 BOUNDARY SIGN, 2.0 FEET NORTHWESTERLY. SET NEW BEARING TREES SCRIBED "BT", WITH 6" MAG SPIKE AND "PLS 7172" STAINLESS STEEL WASHER FOR CHAINING POINT AT CENTER RIGHT SIDE, AND FOREST SERVICE 54-3 BEARING TREE SIGN:
BT1: A 10 INCH FIR, S88°E, 17.5 FEET
BT2: A 10 INCH FIR, S15°E, 65.2 FEET

